

Digital Multimeter Series

734/733/732 Series

- **734** Series of 4.5-digit Handheld Multimeters
- **733/732** Series of 3.5-digit Handheld Multimeters



734 Series

0.020% Maximum Measurement Accuracy
73402




733 Series

RMS Data Measurement
73303



732 Series

Low-end Model
73203

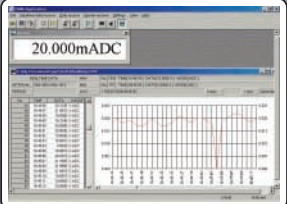- 3.5-digit Digital Multimeter

Digital Multimeter Selection Guide

Model	Type	Display		Measurement Items														Additional Functions											
				Max. Value	Dual	Bar Graph	Back-lit	AC RMS	Voltage	AC + DC	Current	AC + DC A	Resistance	Continuity Check	Diode Test	Frequency	Temperature	Capacitance	Communication	Data Memory	Max./Min. Value Memory	Relative Value Memory	Logarithm Computation	Data Hold	Auto Hold	Peak Hold	Overvoltage	Input Warning	Comparator
73401	Handheld	50000	●	●		●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	
73402			●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	●	
73301		4000		●			●		●		●	●	●		●				●		●	●		●		●	●		
73302				●			●		●		●	●	●	●	●				●		●	●		●		●	●		
73303				●			●	●	●		●	●	●	●	●	●				●		●	●		●		●		●
73201		4300					●		●		●	●	●								●		⊙		●		●		
73202							●		●		●	●	●		●						●		⊙		●		●		
73203							●		●		●	●	●		●							●		⊙		●			●
73204						●				●	●	●									●		⊙		●		●		
753603	Pocket-sized	3200		●			●				●	●	●							●						●			

⊙ : Also functions as excessive current input warning.

Model

73401
73402

4.5 digits

50,000 count

RS-232C

RMS

Terminal shutters

0.020% (73402, DCV)

0.040% (73401, DCV)

3-year Warranty



Maximum Measurement Accuracy

0.020% rdg + 2 dgt (73402, DC voltage)
0.040% rdg + 2 dgt (73401, DC voltage)
RMS measurement for AC and AC+DC measurement
Superior frequency characteristic allows AC measurements from 10 Hz.

Highly Reliable

Calibration screws/dials eliminated

Performance not influenced over time by external factors such as vibration or degradation of electrical contacts of calibration screws/dials.

- Recommended calibration period: 1 year – double the time for conventional 4.5-digit DMMs

Easier Calibration

User calibration function

The 734 series, simply performing special operations via front panel allows for quick and reliable adjustment. In addition, the series allows for one-touch adjustment of AC voltage- and AC current-to-frequency characteristics that could not be adjusted automatically in the past. The user calibration function leads to improved operation efficiency and cost reduction.

- External standard instrument required for calibration.

Full Support of Data Management

Measured data stored in internal memory

Storage Method:

50 data in manual-mode memory + 600 data in logging-mode memory

You can transmit stored data from internal memory to a personal computer, and process them using application software or spreadsheet software (Excel*) for data management.

Supports real-time measurement

Allows you to connect to a personal computer for storing large amounts of data that cannot be stored in DMM internal memory.

- Optional communication package sold separately (Model 92010: communication cable and DMM application software) is required for data transfer.
- The communication cable employs an infrared system, so the device is electrically insulated.

* Excel is a registered trademark of Microsoft Corporation, the United States.

Safe Design

Shutters prevent erroneous insertion of test leads into current measurement terminals (terminal shutters)

The current terminals have terminal shutters that prevent erroneous setting of the measurement function and leadwire connections resulting from operational errors. The terminal shutters open and close according to the function switch position.

Conforms to EN61010-1 safety standard

Conforms to overvoltage category 1000 V AC/DC, CAT II and 600 V AC/DC, CAT III

Loaded with Measurement Functions

Peak hold function (73402, for DC V/A measurement)

Supports waveforms of 1 ms or greater. You can capture instantaneous crest values not possible with ordinary maximum measurement functions.

Relative and percentage value computation


Can display the measured values as the values relative to a reference value (defined by the REL key; even after data hold) or as the percentages of the reference value.

Percentage calculation: (Measured value – reference value) / (reference value), expressed as percentage.

Duty ratio (%) measurement

Displays the duty ratio of a pulse waveform:

(High level period/1 cycle of waveform) x 100 = (t2/t1) x 100 [%]

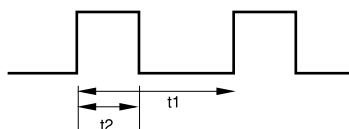

AC+DC measurement

Measures RMS of a waveform in which ripple waveforms are superimposed on a direct current.

Auto hold

Automatically hold the data measured when the test leads are disconnected from the measured object, thus freeing both hands for performing reliable measurement.

Minimum/maximum/average display

Allows recording of minimum, maximum and average values along with their respective times (time passed since the start of measurement)

Decibel calculation

Computes the logarithm of an alternating current, and uses it together with the relative value computation to display the relative value. You can select the standard resistance according to the application, such as audio or communication circuit signal measurement.

* Selectable standard resistance values:

4/8/16/32/50/75/93/110/125/135/150/200/250/300/500/600/800/900/1000/1200Ω

Full Display Functions

50,000-count, 51-segment bar graph display

Allows simultaneous display of frequency and voltage, frequency and duty ratio or decibels and voltage on dual display.

In addition to the above, the sub-display can display the reference value for differential calculation, memory storage numbers for measured data, minimum/maximum/average value recording times, and standard resistance during decibel calculation.

Back-lit display (73402)

Shockproof elastomer casing

An elastomer material is used for the outer casing in order to provide shock absorption and a good grip, in keeping with the requirements of handheld devices.

Communication Functions and Application Software Allow Analyses and Management of Measurement Data

Data Storage Method

Data storage to DMM's internal memory

50 data values in manual-mode memory
600 data values in logging-mode memory units

Transmit to a personal computer all at once
Print out with a printer (Model 97010)

Saving real-time measured data to personal computer

Real-time measured data (only logging measurements)

Transmit to a personal computer in real time
Print out with a printer (Model 97010)

The number of data that can be stored for real-time measurement depends more specifically on the life of the batteries in the DMM.
Reference: The cell life of alkaline batteries is approximately 100 hours when transmitting data in real time while measuring DC voltages at 1-second periods.

Data Management

Management with special application software

You can display measured data as a table and trend graphs. Real-time data transmission allows you to see moment-to-moment changes at a glance. In addition, when displaying DMM data on a PC screen they are enlarged to allow you to easily discern new data.


Data management with Excel* spreadsheet software

The 92010 is provided with a function to import data to an Excel* spreadsheet file, and graphs can be automatically drawn on the spreadsheet. This allows you to use Excel's extensive editing functions to prepare reports in original formats with ease.



Note: During real-time measurement, importing data to an Excel spreadsheet generates only a table containing the measured values. Generation of a graph is possible after completion of measurement.

* Excel is a registered trademark of Microsoft Corporation, the United States.

Data Layout Example on Excel* Spreadsheet

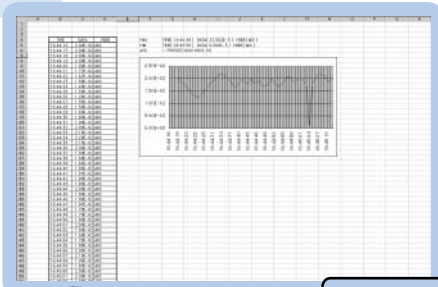

Example of Document Windows in DMM Application Software

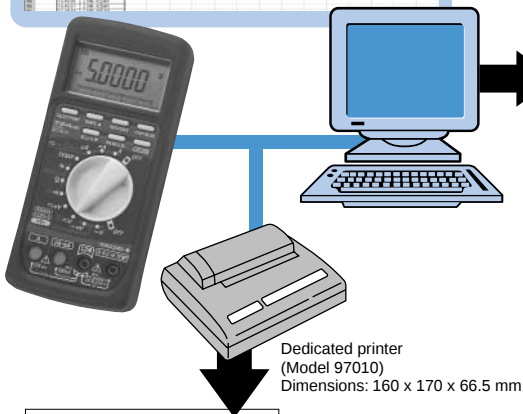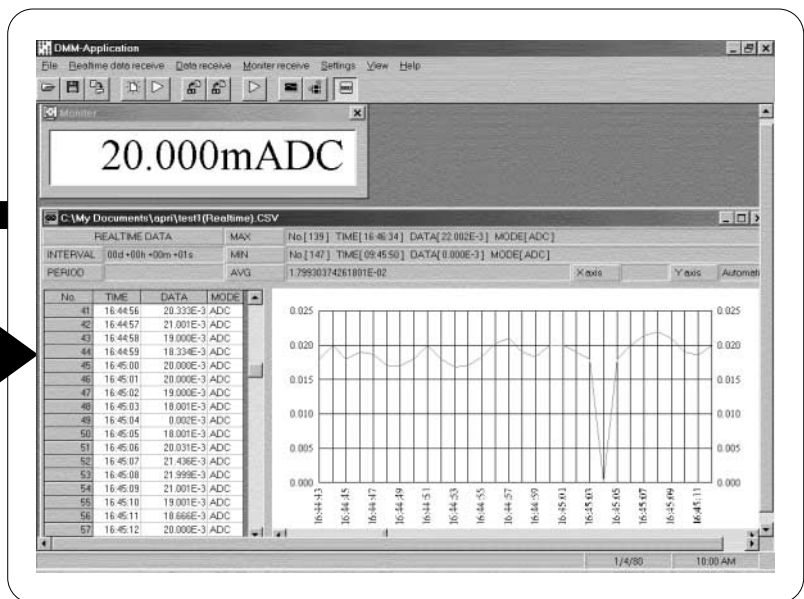

Example Printout of Stored Logging Data

L001 N,+0.9998 VDC
L002 N,+0.9997 VDC
L004 N,+0.9999 VDC
L005 N,+0.9999 VDC
L006 N,+0.9998 VDC
L007 N,+0.9998 VDC
L008 N,+0.9998 VDC
L009 N,+0.9998 VDC
L010 N,+0.9999 VDC
L011 N,+0.9998 VDC
L012 N,+0.9998 VDC
L013 N,+0.9998 VDC
L014 N,+1.0000 VDC
L015 N,+0.9999 VDC
L016 N,+1.0000 VDC
L017 N,+1.0000 VDC
L018 N,+1.0000 VDC
L019 N,+1.0000 VDC
L020 N,+1.0000 VDC
L021 N,+1.0000 VDC
L022 N,+1.0000 VDC
L023 N,+1.0000 VDC
L024 N,+1.0000 VDC
L025 N,+1.0000 VDC
L026 N,+1.0000 VDC
L027 N,+1.0000 VDC
L028 N,+1.0000 VDC
L029 N,+1.0000 VDC
L030 N,+1.0000 VDC
L031 N,+1.0000 VDC
L032 N,+1.0000 VDC
L033 N,+1.0000 VDC
L034 N,+1.0000 VDC
L035 N,+1.0000 VDC
L036 N,+1.0000 VDC
L037 N,+1.0000 VDC
L038 N,+1.0000 VDC
L039 N,+1.0000 VDC
L040 N,+1.0000 VDC
L041 N,+1.0000 VDC
L042 N,+1.0000 VDC
L043 N,+1.0000 VDC
L044 N,+1.0000 VDC
L045 N,+1.0000 VDC
L046 N,+1.0000 VDC
L047 N,+1.0000 VDC
L048 N,+1.0000 VDC
L049 N,+1.0000 VDC
L050 N,+1.0000 VDC
L051 N,+1.0000 VDC
L052 N,+1.0000 VDC
L053 N,+1.0000 VDC
L054 N,+1.0000 VDC
L055 N,+1.0000 VDC
L056 N,+1.0000 VDC
L057 N,+1.0000 VDC
L058 N,+1.0000 VDC
L059 N,+1.0000 VDC
L060 N,+1.0000 VDC
L061 N,+1.0000 VDC
L062 N,+1.0000 VDC
L063 N,+1.0000 VDC
L064 N,+1.0000 VDC
L065 N,+1.0000 VDC
L066 N,+1.0000 VDC
L067 N,+1.0000 VDC
L068 N,+1.0000 VDC
L069 N,+1.0000 VDC
L070 N,+1.0000 VDC
L071 N,+1.0000 VDC
L072 N,+1.0000 VDC
L073 N,+1.0000 VDC
L074 N,+1.0000 VDC
L075 N,+1.0000 VDC
L076 N,+1.0000 VDC
L077 N,+1.0000 VDC
L078 N,+1.0000 VDC
L079 N,+1.0000 VDC
L080 N,+1.0000 VDC
L081 N,+1.0000 VDC
L082 N,+1.0000 VDC
L083 N,+1.0000 VDC
L084 N,+1.0000 VDC
L085 N,+1.0000 VDC
L086 N,+1.0000 VDC
L087 N,+1.0000 VDC
L088 N,+1.0000 VDC
L089 N,+1.0000 VDC
L090 N,+1.0000 VDC
L091 N,+1.0000 VDC
L092 N,+1.0000 VDC
L093 N,+1.0000 VDC
L094 N,+1.0000 VDC
L095 N,+1.0000 VDC
L096 N,+1.0000 VDC
L097 N,+1.0000 VDC
L098 N,+1.0000 VDC
L099 N,+1.0000 VDC
L100 N,+1.0000 VDC
L101 N,+1.0000 VDC
L102 N,+1.0000 VDC
L103 N,+1.0000 VDC
L104 N,+1.0000 VDC
L105 N,+1.0000 VDC
L106 N,+1.0000 VDC
L107 N,+1.0000 VDC
L108 N,+1.0000 VDC
L109 N,+1.0000 VDC
L110 N,+1.0000 VDC
L111 N,+1.0000 VDC
L112 N,+1.0000 VDC
L113 N,+1.0000 VDC
L114 N,+1.0000 VDC
L115 N,+1.0000 VDC
L116 N,+1.0000 VDC
L117 N,+1.0000 VDC
L118 N,+1.0000 VDC
L119 N,+1.0000 VDC
L120 N,+1.0000 VDC
L121 N,+1.0000 VDC
L122 N,+1.0000 VDC
L123 N,+1.0000 VDC
L124 N,+1.0000 VDC
L125 N,+1.0000 VDC
L126 N,+1.0000 VDC
L127 N,+1.0000 VDC
L128 N,+1.0000 VDC
L129 N,+1.0000 VDC
L130 N,+1.0000 VDC
L131 N,+1.0000 VDC
L132 N,+1.0000 VDC
L133 N,+1.0000 VDC
L134 N,+1.0000 VDC
L135 N,+1.0000 VDC
L136 N,+1.0000 VDC
L137 N,+1.0000 VDC
L138 N,+1.0000 VDC
L139 N,+1.0000 VDC
L140 N,+1.0000 VDC
L141 N,+1.0000 VDC
L142 N,+1.0000 VDC
L143 N,+1.0000 VDC
L144 N,+1.0000 VDC
L145 N,+1.0000 VDC
L146 N,+1.0000 VDC
L147 N,+1.0000 VDC
L148 N,+1.0000 VDC
L149 N,+1.0000 VDC
L150 N,+1.0000 VDC
L151 N,+1.0000 VDC
L152 N,+1.0000 VDC
L153 N,+1.0000 VDC
L154 N,+1.0000 VDC
L155 N,+1.0000 VDC
L156 N,+1.0000 VDC
L157 N,+1.0000 VDC
L158 N,+1.0000 VDC
L159 N,+1.0000 VDC
L160 N,+1.0000 VDC
L161 N,+1.0000 VDC
L162 N,+1.0000 VDC
L163 N,+1.0000 VDC
L164 N,+1.0000 VDC
L165 N,+1.0000 VDC
L166 N,+1.0000 VDC
L167 N,+1.0000 VDC
L168 N,+1.0000 VDC
L169 N,+1.0000 VDC
L170 N,+1.0000 VDC
L171 N,+1.0000 VDC
L172 N,+1.0000 VDC
L173 N,+1.0000 VDC
L174 N,+1.0000 VDC
L175 N,+1.0000 VDC
L176 N,+1.0000 VDC
L177 N,+1.0000 VDC
L178 N,+1.0000 VDC
L179 N,+1.0000 VDC
L180 N,+1.0000 VDC
L181 N,+1.0000 VDC
L182 N,+1.0000 VDC
L183 N,+1.0000 VDC
L184 N,+1.0000 VDC
L185 N,+1.0000 VDC
L186 N,+1.0000 VDC
L187 N,+1.0000 VDC
L188 N,+1.0000 VDC
L189 N,+1.0000 VDC
L190 N,+1.0000 VDC
L191 N,+1.0000 VDC
L192 N,+1.0000 VDC
L193 N,+1.0000 VDC
L194 N,+1.0000 VDC
L195 N,+1.0000 VDC
L196 N,+1.0000 VDC
L197 N,+1.0000 VDC
L198 N,+1.0000 VDC
L199 N,+1.0000 VDC
L200 N,+1.0000 VDC
L201 N,+1.0000 VDC
L202 N,+1.0000 VDC
L203 N,+1.0000 VDC
L204 N,+1.0000 VDC
L205 N,+1.0000 VDC
L206 N,+1.0000 VDC
L207 N,+1.0000 VDC
L208 N,+1.0000 VDC
L209 N,+1.0000 VDC
L210 N,+1.0000 VDC
L211 N,+1.0000 VDC
L212 N,+1.0000 VDC
L213 N,+1.0000 VDC
L214 N,+1.0000 VDC
L215 N,+1.0000 VDC
L216 N,+1.0000 VDC
L217 N,+1.0000 VDC
L218 N,+1.0000 VDC
L219 N,+1.0000 VDC
L220 N,+1.0000 VDC
L221 N,+1.0000 VDC
L222 N,+1.0000 VDC
L223 N,+1.0000 VDC
L224 N,+1.0000 VDC
L225 N,+1.0000 VDC
L226 N,+1.0000 VDC
L227 N,+1.0000 VDC
L228 N,+1.0000 VDC
L229 N,+1.0000 VDC
L230 N,+1.0000 VDC
L231 N,+1.0000 VDC
L232 N,+1.0000 VDC
L233 N,+1.0000 VDC
L234 N,+1.0000 VDC
L235 N,+1.0000 VDC
L236 N,+1.0000 VDC
L237 N,+1.0000 VDC
L238 N,+1.0000 VDC
L239 N,+1.0000 VDC
L240 N,+1.0000 VDC
L241 N,+1.0000 VDC
L242 N,+1.0000 VDC
L243 N,+1.0000 VDC
L244 N,+1.0000 VDC
L245 N,+1.0000 VDC
L246 N,+1.0000 VDC
L247 N,+1.0000 VDC
L248 N,+1.0000 VDC
L249 N,+1.0000 VDC
L250 N,+1.0000 VDC
L251 N,+1.0000 VDC
L252 N,+1.0000 VDC
L253 N,+1.0000 VDC
L254 N,+1.0000 VDC
L255 N,+1.0000 VDC
L256 N,+1.0000 VDC
L257 N,+1.0000 VDC
L258 N,+1.0000 VDC
L259 N,+1.0000 VDC
L260 N,+1.0000 VDC
L261 N,+1.0000 VDC
L262 N,+1.0000 VDC
L263 N,+1.0000 VDC
L264 N,+1.0000 VDC
L265 N,+1.0000 VDC
L266 N,+1.0000 VDC
L267 N,+1.0000 VDC
L268 N,+1.0000 VDC
L269 N,+1.0000 VDC
L270 N,+1.0000 VDC
L271 N,+1.0000 VDC
L272 N,+1.0000 VDC
L273 N,+1.0000 VDC
L274 N,+1.0000 VDC
L275 N,+1.0000 VDC
L276 N,+1.0000 VDC
L277 N,+1.0000 VDC
L278 N,+1.0000 VDC
L279 N,+1.0000 VDC
L280 N,+1.0000 VDC
L281 N,+1.0000 VDC
L282 N,+1.0000 VDC
L283 N,+1.0000 VDC
L284 N,+1.0000 VDC
L285 N,+1.0000 VDC
L286 N,+1.0000 VDC
L287 N,+1.0000 VDC
L288 N,+1.0000 VDC
L289 N,+1.0000 VDC
L290 N,+1.0000 VDC
L291 N,+1.0000 VDC
L292 N,+1.0000 VDC
L293 N,+1.0000 VDC
L294 N,+1.0000 VDC
L295 N,+1.0000 VDC
L296 N,+1.0000 VDC
L297 N,+1.0000 VDC
L298 N,+1.0000 VDC
L299 N,+1.0000 VDC
L300 N,+1.0000 VDC
L301 N,+1.0000 VDC
L302 N,+1.0000 VDC
L303 N,+1.0000 VDC
L304 N,+1.0000 VDC
L305 N,+1.0000 VDC
L306 N,+1.0000 VDC
L307 N,+1.0000 VDC
L308 N,+1.0000 VDC
L309 N,+1.0000 VDC
L310 N,+1.0000 VDC
L311 N,+1.0000 VDC
L312 N,+1.0000 VDC
L313 N,+1.0000 VDC
L314 N,+1.0000 VDC
L315 N,+1.0000 VDC
L316 N,+1.0000 VDC
L317 N,+1.0000 VDC
L318 N,+1.0000 VDC
L319 N,+1.0000 VDC
L320 N,+1.0000 VDC
L321 N,+1.0000 VDC
L322 N,+1.0000 VDC
L323 N,+1.0000 VDC
L324 N,+1.0000 VDC
L325 N,+1.0000 VDC
L326 N,+1.0000 VDC
L327 N,+1.0000 VDC
L328 N,+1.0000 VDC
L329 N,+1.0000 VDC
L330 N,+1.0000 VDC
L331 N,+1.0000 VDC
L332 N,+1.0000 VDC
L333 N,+1.0000 VDC
L334 N,+1.0000 VDC
L335 N,+1.0000 VDC
L336 N,+1.0000 VDC
L337 N,+1.0000 VDC
L338 N,+1.0000 VDC
L339 N,+1.0000 VDC
L340 N,+1.0000 VDC
L341 N,+1.0000 VDC
L342 N,+1.0000 VDC
L343 N,+1.0000 VDC
L344 N,+1.0000 VDC
L345 N,+1.0000 VDC
L346 N,+1.0000 VDC
L347 N,+1.0000 VDC
L348 N,+1.0000 VDC
L349 N,+1.0000 VDC
L350 N,+1.0000 VDC
L351 N,+1.0000 VDC
L352 N,+1.0000 VDC
L353 N,+1.0000 VDC
L354 N,+1.0000 VDC
L355 N,+1.0000 VDC
L356 N,+1.0000 VDC
L357 N,+1.0000 VDC
L358 N,+1.0000 VDC
L359 N,+1.0000 VDC
L360 N,+1.0000 VDC
L361 N,+1.0000 VDC
L362 N,+1.0000 VDC
L363 N,+1.0000 VDC
L364 N,+1.0000 VDC
L365 N,+1.0000 VDC
L366 N,+1.0000 VDC
L367 N,+1.0000 VDC
L368 N,+1.0000 VDC
L369 N,+1.0000 VDC
L370 N,+1.0000 VDC
L371 N,+1.0000 VDC
L372 N,+1.0000 VDC
L373 N,+1.0000 VDC
L374 N,+1.0000 VDC
L375 N,+1.0000 VDC
L376 N,+1.0000 VDC
L377 N,+1.0000 VDC
L378 N,+1.0000 VDC
L379 N,+1.0000 VDC
L380 N,+1.0000 VDC
L381 N,+1.0000 VDC
L382 N,+1.0000 VDC
L383 N,+1.0000 VDC
L384 N,+1.0000 VDC
L385 N,+1.0000 VDC
L386 N,+1.0000 VDC
L387 N,+1.0000 VDC
L388 N,+1.0000 VDC
L389 N,+1.0000 VDC
L390 N,+1.0000 VDC
L391 N,+1.0000 VDC
L392 N,+1.0000 VDC
L393 N,+1.0000 VDC
L394 N,+1.0000 VDC
L395 N,+1.0000 VDC
L396 N,+1.0000 VDC
L397 N,+1.0000 VDC
L398 N,+1.0000 VDC
L399 N,+1.0000 VDC
L400 N,+1.0000 VDC
L401 N,+1.0000 VDC
L402 N,+1.0000 VDC
L403 N,+1.0000 VDC
L404 N,+1.0000 VDC
L405 N,+1.0000 VDC
L406 N,+1.0000 VDC
L407 N,+1.0000 VDC
L408 N,+1.0000 VDC
L409 N,+1.0000 VDC
L410 N,+1.0000 VDC
L411 N,+1.0000 VDC
L412 N,+1.0000 VDC
L413 N,+1.0000 VDC
L414 N,+1.0000 VDC
L415 N,+1.0000 VDC
L416 N,+1.0000 VDC
L417 N,+1.0000 VDC
L418 N,+1.0000 VDC
L419 N,+1.0000 VDC
L420 N,+1.0000 VDC
L421 N,+1.0000 VDC
L422 N,+1.0000 VDC
L423 N,+1.0000 VDC
L424 N,+1.0000 VDC
L425 N,+1.0000 VDC
L426 N,+1.0000 VDC
L427 N,+1.0000 VDC
L428 N,+1.0000 VDC
L429 N,+1.0000 VDC
L430 N,+1.0000 VDC
L431 N,+1.0000 VDC
L432 N,+1.0000 VDC
L433 N,+1.0000 VDC
L434 N,+1.0000 VDC
L435 N,+1.0000 VDC
L436 N,+1.0000 VDC
L437 N,+1.0000 VDC
L438 N,+1.0000 VDC
L439 N,+1.0000 VDC
L440 N,+1.0000 VDC
L441 N,+1.0000 VDC
L442 N,+1.0000 VDC
L443 N,+1.0000 VDC
L444 N,+1.0000 VDC
L445 N,+1.0000 VDC
L446 N,+1.0000 VDC
L447 N,+1.0000 VDC
L448 N,+1.0000 VDC
L449 N,+1.0000 VDC
L450 N,+1.0000 VDC
L451 N,+1.0000 VDC
L452 N,+1.0000 VDC
L453 N,+1.0000 VDC
L454 N,+1.0000 VDC
L455 N,+1.0000 VDC
L456 N,+1.0000 VDC
L457 N,+1.0000 VDC
L458 N,+1.0000 VDC
L459 N,+1.0000 VDC
L460 N,+1.0000 VDC
L461 N,+1.0000 VDC
L462 N,+1.0000 VDC
L463 N,+1.0000 VDC
L464 N,+1.0000 VDC
L465 N,+1.0000 VDC
L466 N,+1.0000 VDC
L467 N,+1.0000 VDC
L468 N,+1.0000 VDC
L469 N,+1.0000 VDC
L470 N,+1.0000 VDC
L471 N,+1.0000 VDC
L472 N,+1.0000 VDC
L473 N,+1.0000 VDC
L474 N,+1.0000 VDC
L475 N,+1.0000 VDC
L476 N,+1.0000 VDC
L477 N,+1.0000 VDC
L478 N,+1.0000 VDC
L479 N,+1.0000 VDC
L480 N,+1.0000 VDC
L481 N,+1.0000 VDC
L482 N,+1.0000 VDC
L483 N,+1.0000 VDC
L484 N,+1.0000 VDC
L485 N,+1.0000 VDC
L486 N,+1.0000 VDC
L487 N,+1.0000 VDC
L488 N,+1.0000 VDC
L489 N,+1.0000 VDC
L490 N,+1.0000 VDC
L491 N,+1.0000 VDC
L492 N,+1.0000 VDC
L493 N,+1.0000 VDC
L494 N,+1.0000 VDC
L495 N,+1.0000 VDC
L496 N,+1.0000 VDC
L497 N,+1.0000 VDC
L498 N,+1.0000 VDC
L499 N,+1.0000 VDC
L500 N,+1.0000 VDC
L501 N,+1.0000 VDC
L502 N,+1.0000 VDC
L503 N,+1.0000 VDC
L504 N,+1.0000 VDC
L505 N,+1.0000 VDC
L506 N,+1.0000 VDC
L507 N,+1.0000 VDC
L508 N,+1.0000 VDC
L509 N,+1.0000 VDC
L510 N,+1.0000 VDC
L511 N,+1.0000 VDC
L512 N,+1.0000 VDC
L513 N,+1.0000 VDC
L514 N,+1.0000 VDC
L515 N,+1.0000 VDC
L516 N,+1.0000 VDC
L517 N,+1.0000 VDC
L518 N,+1.0000 VDC
L519 N,+1.0000 VDC
L520 N,+1.0000 VDC
L521 N,+1.0000 VDC
L522 N,+1.0000 VDC
L523 N,+1.0000 VDC
L524 N,+1.0000 VDC
L525 N,+1.0000 VDC
L526 N,+1.0000 VDC
L527 N,+1.0000 VDC
L528 N,+1.0000 VDC
L529 N,+1.0000 VDC
L530 N,+1.0000 VDC
L531 N,+1.0000 VDC
L532 N,+1.0000 VDC
L533 N,+1.0000 VDC
L534 N,+1.0000 VDC
L535 N,+1.0000 VDC
L536 N,+1.0000 VDC
L537 N,+1.0000 VDC
L538 N,+1.0000 VDC
L539 N,+1.0000 VDC
L540 N,+1.0000 VDC
L541 N,+1.0000 VDC
L542 N,+1.0000 VDC
L543 N,+1.0000 VDC
L544 N,+1.0000 VDC
L545 N,+1.0000 VDC
L546 N,+1.0000 VDC
L547 N,+1.0000 VDC
L548 N,+1.0000 VDC
L549 N,+1.0000 VDC
L550 N,+1.0000 VDC
L551 N,+1.0000 VDC
L552 N,+1.0000 VDC
L553 N,+1.0000 VDC
L554 N,+1.0000 VDC
L555 N,+1.0000 VDC
L556 N,+1.0000 VDC
L557 N,+1.0000 VDC
L558 N,+1.0000 VDC
L559 N,+1.0000 VDC
L560 N,+1.0000 VDC
L561 N,+1.0000 VDC
L562 N,+1.0000 VDC
L563 N,+1.0000 VDC
L564 N,+1.0000 VDC
L565 N,+1.0000 VDC
L566 N,+1.0000 VDC
L567 N,+1.0000 VDC
L568 N,+1.0000 VDC
L569 N,+1.0000 VDC
L570 N,+1.0000 VDC
L571 N,+1.0000 VDC
L572 N,+1.0000 VDC
L573 N,+1.0000 VDC
L574 N,+1.0000 VDC
L575 N,+1.0000 VDC
L576 N,+1.0000 VDC
L577 N,+1.0000 VDC
L578 N,+1.0000 VDC
L579 N,+1.0000 VDC
L580 N,+1.0000 VDC
L581 N,+1.0000 VDC
L582 N,+1.0000 VDC
L583 N,+1.0000 VDC
L584 N,+1.0000 VDC
L585 N,+1.0000 VDC
L586 N,+1.0000 VDC
L587 N,+1.0000 VDC
L588 N,+1.0000 VDC
L589 N,+1.0000 VDC
L590 N,+1.0000 VDC
L591 N,+1.0000 VDC
L592 N,+1.0000 VDC
L593 N,+1.0000 VDC
L594 N,+1.0000 VDC
L595 N,+1.0000 VDC
L596 N,+1.0000 VDC
L597 N,+1.0000 VDC
L598 N,+1.0000 VDC
L599 N,+1.0000 VDC
L600 N,+1.0000 VDC
L601 N,+1.0000 VDC
L602 N,+1.0000 VDC
L603 N,+1.0000 VDC
L604 N,+1.0000 VDC
L605 N,+1.0000 VDC
L606 N,+1.0000 VDC
L607 N,+1.0000 VDC
L608 N,+1.0000 VDC
L609 N,+1.0000 VDC
L610 N,+1.0000 VDC
L611 N,+1.0000 VDC
L612 N,+1.0000 VDC
L613 N,+1.0000 VDC
L614 N,+1.0000 VDC
L615 N,+1.0000 VDC
L616 N,+1.0000 VDC
L617 N,+1.0000 VDC
L618 N,+1.0000 VDC
L619 N,+1.0000 VDC
L620 N,+1.0000 VDC
L621 N,+1.0000 VDC
L622 N,+1.0000 VDC
L623 N,+1.0000 VDC
L624 N,+1.0000 VDC
L625 N,+1.0000 VDC
L626 N,+1.0000 VDC
L627 N,+1.0000 VDC
L628 N,+1.0000 VDC
L629 N,+1.0000 VDC
L630 N,+1.0000 VDC
L631 N,+1.0000 VDC
L632 N,+1.0000 VDC
L633 N,+1.0000 VDC
L634 N,+1.0000 VDC
L635 N,+1.0000 VDC
L636 N,+1.0000 VDC
L637 N,+1.0000 VDC
L638 N,+1.0000 VDC
L639 N,+1.0000 VDC
L640 N,+1.0000 VDC
L641 N,+1.0000 VDC
L642 N,+1.0000 VDC
L643 N,+1.0000 VDC
L644 N,+1.0000 VDC
L645 N,+1.0000 VDC
L646 N,+1.0000 VDC
L647 N,+1.0000 VDC
L648 N,+1.0000 VDC
L649 N,+1.0000 VDC
L650 N,+1.0000 VDC
L651 N,+1.0000 VDC
L652 N,+1.0000 VDC
L653 N,+1.0000 VDC
L654 N,+1.0000 VDC
L655 N,+1.0000 VDC
L656 N,+1.0000 VDC
L657 N,+1.0000 VDC
L658 N,+1.0000 VDC
L659 N,+1.0000 VDC
L660 N,+1.0000 VDC
L661 N,+1.0000 VDC
L662 N,+1.0000 VDC
L663 N,+1.0000 VDC
L664 N,+1.0000 VDC
L665 N,+1.0000 VDC
L666 N,+1.0000 VDC
L667 N,+1.0000 VDC
L668 N,+1.0000 VDC
L669 N,+1.0000 VDC
L670 N,+1.0000 VDC
L671 N,+1.0000 VDC
L672 N,+1.0000 VDC
L673 N,+1.0000 VDC
L674 N,+1.0000 VDC
L675 N,+1.0000 VDC
L676 N,+1.0000 VDC
L677 N,+1.0000 VDC
L678 N,+1.0000 VDC
L679 N,+1.0000 VDC
L680 N,+1.0000 VDC
L681 N,+1.0000 VDC
L682 N,+1.0000 VDC
L683 N,+1.0000 VDC
L684 N,+1.0000 VDC
L685 N,+1.0000 VDC
L686 N,+1.0000 VDC
L687 N,+1.000

General Specifications of 73401 / 02		Optional Accessories			
Additional Functions	RS-232C, data memory, max/mini value memory, relative /percentage value computation, logarithm computation, data/auto hold, peak hold (73402), overvoltage warning, backlight(73402)	Name	Model	Specification	
Display	Digital display: 50,000-count digital reading and 51-segment bar graph	DMM communication package	92010-E	RS-232C cable + DMM software	
Measuring Rate	Digital display: 3 times/sec Bar graph display: 10 times/sec	Temperature probe	92010-E/P	As above + Model 91015	
Operating Temp. and Humidity	-10°C to 50°C; 80% RH or less at -10°C to 40°C, or 70% RH or less at 40°C to 50°C (no condensation)		90050	For liquids: -50°C to 600°C	
	-25°C to 60°C, 70 RH or less (no condensation)		90051	For liquids: -50°C to 600°C	
Storage Temp. and Humidity	Add the accuracy 0.05/°C to the basic accuracy at a temperature within -10°C to 18°C and 28°C to 50°C		90055	For surfaces: -20°C to 250°C	
	5.55 kV, AC for 1 minute (between input terminals and casing)		90056	For surfaces: -20°C to 500°C	
Power Supply	Two AA (R6) dry cells	Carrying case (hard)	B9646HH	Houses the DMM and test leads.	
Battery Life	Approx. 120 hours (for continuous DC voltage measurement with alkaline cells)		93014	Houses the DMM, probes, and RS-232C cable.	
Auto Power Off	The power is automatically turned off when no operation is made for approx. 20 minutes (can be disabled).	Test leads	RD031	Red / black (1 set)	
Dimensions	85 (W) x 191 (H) x 40 (D) mm	Fuse	A1518EF	500 mA/600 V	
	Approximately 450 g (including batteries)		A1519EF	15 A/600 V	
Compliance with Standards	Safety EN61010-1 (1995); EN61010-2-031 (1995) (AC/DC 1000 V, CAT II; AC/DC600 V, CAT III)	Printer	97010		
	EMC EMI: EN55011 (1998); EN61326-1 (1998) + A1 (Class B, Group 1)	AC adapter for printer	94006	For Europe	
	EMS: EN50082-1 (1997); EN61326-1 (1998) + A1		94007	For USA	
	Instruction manual:1, Test lead set (RD031):1, AA (R6) dry cells(built in):2	Thermal printing paper	97080	10 rolls	
		RS-232C cable	91015	For printer connection (male-male; 9-pin D-sub)	

Performance

Test conditions: Temperature and humidity = 23°C ± 5°C, 80% RH or less; Accuracy = ±(% rdg + dgt).
 Note: A response time is the time required for achieving the accuracy specified for the corresponding range.

• DC Voltage Measurement (V)

DC Voltage Measurements (V _{DC})				
Range	Accuracy		Input Resistance	Maximum Input Voltage
	73401	73402		
50.000 mV	0.1 + 10	0.05 + 10	Approx. 100 MΩ	1000 Vrms AC, 1000 V DC
500.00 mV	0.04 + 2	0.02 + 2		
240.00 mV				
5.0000 V		0.025 + 5	10 MΩ	
50.000 V	0.07 + 2	0.03 + 2		
500.0 V				
1000.0 V				

Response time: 1 second or less
 NMRR: 80 dB or greater for 50/60 Hz ± 0.1%
 CMRR: 120 dB or greater for 50/60 Hz (Rs = 1 kΩ)

• AC Voltage Measurement (V)

Model 73401 AC coupling, RMS detection, crest factor: <3					
Range	Accuracy				Maximum Input Voltage
	10 – 20 Hz	20 Hz – 1 kHz	1 – 10 kHz	10 – 20 kHz	
500.00 mV	*1 1.5+30	*1 0.7+30	*1 0.7+30	*2 2+50	1000 Vrms AC, 1000 V DC
5.0000 V					
50.000 V					
500.00 V					
1000.0 V	*2	*2	3 + 30 *2	—	

Model 73402 AC coupling, RMS detection, crest factor: <3							
Range	Accuracy						Maximum Input Voltage
	10 – 20 Hz	20 Hz – 1 kHz	1 – 10 kHz	10 – 20 kHz	20 – 50 kHz	50 – 100 kHz	
500.00 mV	*1 1 + 30	*1 0.4 + 30	*1 0.4 + 30	*1 1 + 40	*2 2 + 70	*2 5 + 200	1000 Vrms AC, 1000 V DC
5.0000 V							
50.000 V							
500.00 V							
1000.0 V	*2	*2	3 + 30 *2	—	—	—	

*1: At 5 to 100% of range *2: At 10 to 100% of range
 Response time: 2 seconds or less
 CMRR: 80 dB or greater for DC to 60 Hz (Rs = 1 kΩ)

• DC Voltage + AC Voltage (V + V)

Model 73401 Maximum effective display: 5000; crest factor: <3					
Range	Accuracy				Maximum Input Voltage
	DC, 10 – 20 Hz	DC, 20 Hz – 1 kHz	DC, 1 – 10 kHz	DC, 10 – 20 kHz	
5.000 V	*1 1.5 + 10	*1 1 + 10	*1 1 + 10	*1 2 + 10	1000 Vrms AC, 1000 V DC
50.00 V					
500.0 V					
1000 V					

Model 73402 Maximum effective display: 5000; crest factor: <3							
Range	Accuracy						Maximum Input Voltage
	10 – 20 Hz	20 Hz – 1 kHz	1 – 10 kHz	10 – 20 kHz	20 – 50 kHz	50 – 100 kHz	
5.000 V	*1 1.5 + 10	*1 0.5 + 10	*1 0.5 + 10	*1 1 + 10	*2 2 + 10	*2 5 + 20	1000 Vrms AC, 1000 V DC
50.00 V							
500.0 V							
1000 V							

*1: At 5 to 100% of range *2: At 10 to 100% of range
 Response time: Approximately 5 seconds
 CMRR: 80 dB or greater for DC to 60 Hz (Rs = 1 kΩ)

• AC Current Measurement (A)

Model 73401 Crest factor: <3			
Range	Accuracy		Maximum Input Voltage
	10 – 20 Hz	20 Hz – 1 kHz	
500.00 μA	1.5 + 20	1 + 20	<0.11 mV/μA
5000.0 μA			500 mA (fuse-protected)
50.000 mA			<4 mV/mA
500.00 mA			15 A (fuse-protected)
5.0000 A			<0.1 V/A

Model 73402 Crest factor: <3			
Range	Accuracy		Maximum Input Voltage
	10 – 20 Hz	20 Hz – 1 kHz	
500.00 μA	1 + 20	0.75 + 20	<0.11 mV/μA
5000.0 μA			500 mA (fuse-protected)
50.000 mA			<4 mV/mA
500.00 mA			15 A (fuse-protected)
5.0000 A			<0.1 V/A

Shown above are the accuracy at 5 to 100% of range (10 to 100% for 10 A range).
 Response time: 2 seconds or less

• DC Current Measurement (A)

Accuracy			
Range	73401/02	Voltage Drop	Maximum Input Current
500.00 μA	0.2 + 2	<0.11 mV/μA	500 mA (fuse-protected)
5000.0 μA		<4 mV/mA	
50.000 mA			
500.00 mA		0.6 + 2	<0.1 V/A
5.0000 A			
10.000 A			

Response time: 1 second or less

• DC Current + AC Current (A + A)

Model 73401		Maximum effective reading: 5000; crest factor: <3		
Range	Accuracy		Voltage Drop	Maximum Input Current
	DC, 10 – 20 Hz	DC, 20 Hz – 1 kHz		
500.0 μA	2 + 10	1.5 + 10	<0.11 mV/μA	500 mA (fuse-protected)
5000.0 μA				
50.00 mA				
500.0 mA			<4 mV/mA	
5.000 A			<0.1 V/A	15 A (fuse-protected)
10.00 A				

Model 73402 Maximum effective reading: 5000; crest factor: <3				
Range	Accuracy			Maximum Input Current
	DC, 10 – 20 Hz	DC, 20 Hz – 1 kHz	DC, 1 – 5 kHz	
500.0 μA	1.5 + 10	1 + 10	1.5 + 10	500 mA (fuse-protected)
5000.0 μA				
50.000 mA				
500.0 mA				15 A (fuse-protected)
5.000 A				

Shown above is the accuracy at 5 to 100% of range (10 to 100% for 10 A range).
 Response time: Approximately 5 seconds

• Resistance Measurement (Ω)

Accuracy		Maximum Testing Current	Open-circuit Voltage	Input Protection Voltage		
Range	73401				73402	
500.00 Ω	0.1 + 2 ^{*1}	0.05 + 2 ^{*1}	<1 mA	<2.5 V	600 Vrms	
5.0000 kΩ			<0.25 mA			
50.000 kΩ			<25 μA			
500.00 kΩ			<2.5 μA			
5.0000 MΩ	0.5 + 2		<1.5 μA			
50.000 MΩ	1 + 2		<0.13 μA			

*1: Accuracy after zero calibration
 Response time: 3 seconds or less for 500 Ω to 500 kΩ, 10 seconds or less for 5 MΩ to 50 MΩ

• Continuity Check ()

Maximum effective display: 5000				
Range	Continuity Beeper	Testing Current	Open-circuit Voltage	Input Protection Voltage
500.0 Ω	Buzzer sounds at 100 ± 50 Ω or less.	Approx. 0.5 mA	<5 V	600 Vrms

• Diode Test (V)

Range	Accuracy	Testing Current (Vf = 0.6 V)	Open-circuit Voltage	Input Protection Voltage
2.4000 V	1 + 2	Approx. 0.5 mA	<5 V	600 Vrms

• Temperature Measurement (TEMP)

Range	Accuracy	Input Protection Voltage
-50.0°C to 800.0°C	1 + 1.5°C	600 Vrms

Temperature probe:
 Type K thermocouple sensor (optional)

• Frequency Measurement (Hz)

Maximum effective display: 9999		
Range (auto-ranging)	Accuracy	Input Range
2.000 – 9.999 Hz	0.02 + 1	10 to 100% of range
9.00 – 99.99 Hz		
90.0 – 999.9 Hz		
900 – 9999 Hz		
9.00 – 99.99 kHz		40 to 100% of range

• Capacitance Measurement (F)

Maximum effective display: 5000		
Range	Accuracy	Input Protection Voltage
5.000 nF	1 + 5 *1	600 Vrms
50.00 nF		
500.0 nF		
5.000 μF		
50.00 μF		
500.0 μF	2 + 5	
5.000 mF	3 + 5	
50.00 mF		

*1: Accuracy after zero calibration

• Duty Cycle Measurement (%)

Range	Accuracy	Input Range
10 – 90%	±1% *1	40 to 100% of range

*1: For input of a square wave with a frequency within 10.00 to 500.0 Hz

• Peak Hold Function (PH)

(73402 only) Maximum effective display: 5000		
Range	Accuracy	Response Time
DC V, DC A	±100 digits	>1 ms

733
Series

Provides Safety Levels Demanded in Field Work

Model

73301
73302
73303

3.5
digits

4000
count

RMS
(73303)

Terminal
shutters

0.2%
(73302/03, DCV)

0.3%
(73301, DCV)

3-year
Warranty



RMS and Mean Value Measurement Models Available

0.2% rdg + 1 dgt (73302/03, for DC voltage)
0.3% rdg + 1 dgt (73301, for DC voltage)
AC RMS value measurement (73303)

Increased Safety for Use in the Field Safe Design Prevents Human Error

Terminal shutters prevent erroneous insertion of test leads into current measurement terminals

If the function is switched to voltage measurement while a test lead is left inserted into a current measurement terminal, neither the fuse built into the current measurement circuit of the DMM nor the input protection circuit for voltage measurement can protect the circuits. The terminal shutters prevent the rotary switch from being moved from the current measurement function while a test lead is inserted into a current measurement terminal, thus preventing erroneous settings due to human error and ensuring the safety of the user. The terminal shutters open and close with operation of the function select (rotary) switch, so operation efficiency is not sacrificed.



Current measurement

Set to a current measurement function.



Terminal shutters are open.



Measurement other than current


Set to a function other than current measurement.



Terminal shutters are closed.

Employs high-performance fuses rated at 100 kA

Uses withstand current fuses with an arc extinguishing material for an assured prearcing time-current characteristic in the event of an excessive current.



Rated breaking current:
100 kA for both

Elastomer material used for impact absorption

An elastomer material that provides better grip and impact resistance than conventional ABS resin or polycarbonate is used for the casing of the meter thus improving both safety and ease of use.



To highlight the elastomer construction it is colored in this photograph.

Conforms to EN61010-10 Safety Standard

Conforms to overvoltage category AC/DC 1000 V, CAT II, and AC/DC 600 V CATIII.


Satisfying Performance with Concentrated Functionality

AC voltage measurement method selectable between RMS value and mean value measurement (73303)


You can compare the waveform of the measured AC voltage with a sine wave to check for distortion. If the measured RMS value is not equal to the measured mean value, you can conclude that the waveform deviates from the sine wave.

Relative and percentage value computation

Displays the measured values as relative values with respect to a reference measurement or as the percentages with respect to the reference measurement.



Sets currently measured value as reference value.



Displays only the differential (the voltage has decreased to 90 V).




Displays the change as a percentage (%).

Zero calibration for stray capacitance when checking capacitors (73302/03)

The stray capacitance of the instrument can be zeroed by using this function with the test leads open (only when the 10 nF range is selected).

Auto hold function


Just removing the test leads from the measured object retains the measured value. Because the measurement is held, there is no need to operate the hold switch for each measurement, freeing both hands for performing safe and accurate measurements with the test leads.

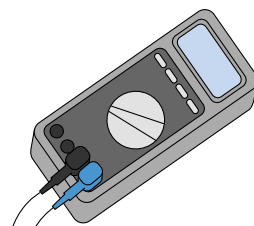

Standard Instrument

User calibration


You can easily perform calibration and adjustment using the panel keys on the multimeter and standard instrument—optimal for maintaining accuracy of measurement instruments required by ISO9000 international standards for quality systems.

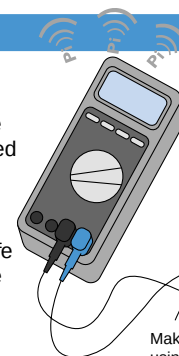


Emits intermittent beeps when measurement has stabilized.

Data is retained by simply removing test leads.

Make reliable measurements using both hands




The calibration mode is enabled by powering up the multimeter using special procedures.




Adjustment is performed with a single key operation.

General Specifications of		73301 / 02 / 03	Optional Accessories	
Additional Functions	Relative and percentage value computation, data / auto hold, overvoltage warning			
Display	Digital display: 4,000-count digital reading; 40-segment bar graph			
Measuring Rate	Digital display: 2.3 times/sec Bar graph display: 23 times/sec			
Operating Temp. and Humidity	-10°C to 50°C; 80% RH or less at -10°C to 40°C, or 70% RH or less at 40°C to 50°C (no condensation)			
Storage Temp. and Humidity	-20°C to 60°C, 70 RH or less (no condensation)			
Temperature Coefficient	Add the accuracy (0.1°C to the basic accuracy at a temperature within -10°C to 18°C and 28°C to 50°C			
Withstanding Voltage	5.55 kV AC for 1 minute (between input terminals and casing)			
Power Supply	Two AA (R6) dry cells			
Battery Life	73301: Approx. 1000 hours (for continuous DC voltage measurement with alkaline cells)			
	73302/03: Approx. 350 hours measurement with alkaline cells)			
Auto Power Off	The power is automatically turned off when no operation is made for approx. 20 minutes (can be disabled).			
Dimensions	85 (W) x 191 (H) x 40 (D) mm			
Weight	Approximately 450 g (including batteries)			
Compliance with Standards	Safety EN61010-1 (1995); EN61010-2-031 (1995) (AC/DC 1000 V, CAT II; AC/DC 600 V, CAT III)			
	EMC EMI: EN55011 (1998); EN61326-1 (1998) + A1(Class B, Group 1)			
	EMS: EN50082-1 (1997); EN61326-1 (1998) + A1			
Standard Accessories	Instruction manual:1, Test lead set (RD031):1, AA (R6) dry cells(built in):2			

Name	Model	Specification
Fuse	A1518EF	500 mA/600 V
	A1519EF	15 A/600 V
Test leads	RD031	Red / black (1 set)
Thermistor probe	234901	-50°C to 150°C
Carrying case (hard)	B9646HH	Houses the DMM and test leads



Name	Model	Specification
Fuse	A1518EF	500 mA/600 V
	A1519EF	15 A/600 V
Test leads	RD031	Red / black (1 set)
Thermistor probe	234901	-50°C to 150°C
Carrying case (hard)	B9646HH	Houses the DMM and test leads

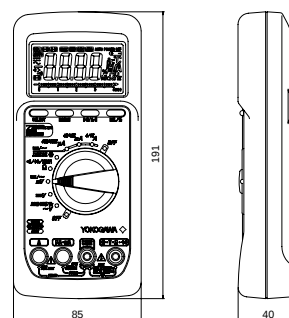

Performance

Test conditions: Temperature and humidity = 23°C ± 5°C, 80% RH or less; Accuracy = ±(% rdg + dgt).
Note: A response time is the time required for achieving the accuracy specified for the corresponding range.

• DC Voltage Measurement (V)

Range	Accuracy		Input Resistance	Maximum Input Voltage
	73301	73302/03		
400.0 mV fixed	0.3% + 1	0.2% + 1	10 MΩ	1000 Vrms AC, 1000 V DC
4.000 V			11 MΩ	
40.00 V			10 MΩ	
400.0 V				
1000 V				

Response time: 1 second or less

• AC Voltage Measurement (V)

Model 73301			Mean-value detection and RMS-value calibration			
Range	Accuracy			Input Impedance	Maximum Input Voltage	
	50/60 Hz	50 – 500 Hz	500 Hz – 1 kHz			
400.0 mV fixed	0.5% + 2	1% + 2	1.5% + 4	10 MΩ, <50 pF	1000 Vrms AC, 1000 V DC	
4.000 V				11 MΩ, <50 pF		
40.00 V				10 MΩ, <50 pF		
400.0 V						
1000 V						

Response time: 2 seconds or less

Model 73302			Mean-value detection and RMS-value calibration			
Range	Accuracy			Input Impedance	Maximum Input Voltage	
	50/60 Hz	50 – 500 Hz	500 Hz – 1 kHz			
400.0 mV fixed	0.5% + 2	0.75% + 2	1.5% + 4	10 MΩ, <50 pF	1000 Vrms AC, 1000 V DC	
4.000 V				11 MΩ, <50 pF		
40.00 V				10 MΩ, <50 pF		
400.0 V						
1000 V						

Response time: 2 seconds or less

Model 73303						RMS detection, and mean-value detection and RMS-value calibration(except 400 mV range)					
Range		Accuracy			Input Impedance	Maximum Input Voltage					
		50/60 Hz	50 – 500 Hz	500 Hz – 1 kHz							
400.0 mV fixed	0.5% + 5	1% + 5	1.5% + 5	10 MΩ, <50 pF	1000 Vrms AC, 1000 V DC						
4.000 V				11 MΩ, <50 pF							
40.00 V				10 MΩ, <50 pF							
400.0 V											
1000 V											

Response time: 2 seconds or less; crest factor: <3
*1: 5 to 100% of F.S., or 200 to 1000 V for 1000 V range:

• DC Current Measurement (A)

Range	Accuracy		Voltage Drop	Maximum Input Current
	73301	73302/03		
400.0 μA	1% + 2	0.5% + 2	<0.11 mV/μA	400 mA (500 mA/600 V fuse-protected)
4000 μA				
40.00 mA				
400.0 mA				
4.000 A	1.2% + 2		<2.5 mV/mA	10 A (15 A/600 V fuse-protected)
10.00 A			<0.1 V/A	

Response time: 1 second or less

• AC Current Measurement (A)

Current measurement (A)		Mean-value detection and RMS calibration		
Model 73301	Accuracy			
Range	50/60 Hz	40 Hz – 1 kHz	Voltage Drop	Maximum Input Current
400.0 μA	1% + 5	1.5% + 5	<0.11 mV/μA	400 mA (500 mA/600 V fuse-protected)
4000 μA				
40.00 mA				
400.0 mA				
4.000 A	1.2% + 5		<2.5 mV/mA	10 A (15 A/600 V fuse-protected)
10.00 A				

Response time: 2 seconds or less

• AC Current Measurement (A)

Models 73302/03					RMS-value detection (73303 only), and mean-value detection and RMS calibration				
Range		Accuracy		Voltage Drop	Maximum Input Current				
		50/60 Hz	40 Hz – 1 kHz						
400.0 μA	0.75% + 5 ^{*1}	1.5% + 5	<0.11 mV/μA	400 mA (500 mA/600 V fuse-protected)					
4000 μA			<2.5 mV/mA						
40.00 mA									
400.0 mA									
4.000 A	1% + 5 ^{*1}		<0.1 V/A	10 A (15 A/600 V fuse-protected)					
10.00 A									

Response time: 3 sec or less; crest factor: <3 (73303 only)
*1: 5 to 100% of F.S., 2 – 10 A for 10 A range (73303 only)

• Resistance Measurement (Ω)

Range	Accuracy		Maximum Testing Current	Open-circuit Voltage	Input Protection Voltage
	73301	73302/03			
400.0 Ω	0.5% + 1*	0.4% + 1*	<1.4 mA	<2.5 V	600 Vrms
4.000 kΩ			<120 μA	<1.3 V	
40.00 kΩ			<13 μA		
400.0 kΩ			<1.3 μA		
4.000 MΩ		0.5% + 1			
40.00 MΩ	1% + 2		<130 nA		

Response time: 2 seconds or less for 400 Ω range, 10 seconds or less for 4 MΩ range or greater
*: Accuracy after zero calibration for 400 Ω range

• Continuity Check ()

Range	Continuity Beeper	Maximum Testing Current	Open-circuit Voltage	Input Protection Voltage
400.0 Ω	Buzzer sounds at 20 Ω or less.	0.8 mA	<3.4 V	600 Vrms

• Diode Test (→|←)

Range	Accuracy	Testing Current (Vf = 0.6 V)	Open-circuit Voltage	Input Protection Voltage
2.000 V	1% + 2	Approximately 0.5 mA	<3.4 V	600 Vrms

• Temperature Measurement (TEMP)

Range	Accuracy	Input Protection Voltage
-50.0°C to 150.0°C	0°C to 70.0°C: ±1°C -30.0°C to 0°C or 70.0°C to 150.0°C: ±2°C	600 Vrms

Accuracy when used in combination with optional thermistor probe (234901)

• Capacitor Check (→|←)

Range	Accuracy		Input Protection Voltage
	73301	73302/03	
10.00 nF	2% + 10 (after zero calibration)	2% + 5	600 Vrms
100.0 nF			
1000 nF			
10.00 μF			
100.0 μF			
1000 μF	3% + 5		

• Frequency Measurement (Hz)

Models 73302/03 (function not available with 73301)				
Range	Accuracy	Input Voltage Range	Maximum Input Voltage	
	73302/03			
10.00 – 99.99 Hz	0.02% + 1	0.2 – 400 Vrms	600 Vrms	
90.0 – 999.9 Hz				
900 – 9999 Hz		0.4 – 400 Vrms		
9.00 – 99.99 kHz		0.8 – 100 Vrms	100 Vrms	

Coupling type: AC coupling

Model

73201
73202
73203
73204

3.5 digits

4300 count

3-year Warranty

• Photo shows the 73203 with optional rubber case.



- Compact size, ideal for carrying
- Large display for easy viewing
- Safe design allows measurement in excess of 20 A (excluding 73204)
- Special model for voltage measurement (73204)
- Simple auto hold function
- Capacitors can be checked (73202/73203)

Low-cost Handheld DMM

General Specifications

73201 / 02 / 03 / 04

Additional Functions	Auto hold, overvoltage and current warning
Display	Digital display: 4300-count digital reading
Measuring Rate	Digital display: Approx. 2 times/sec
Operating Temp. and Humidity	0 to 50°C; 80% RH or less at 0°C to 40°C, or 70% RH or less at 40°C to 50°C (no condensation)
Storage Temp. and Humidity	-20°C to 60°C, 70 RH or less (no condensation)
Temperature Coefficient	Add accuracy x 0.1/°C to the basic accuracy at a temperature within 0°C to 18°C and 28°C to 50°C
Withstanding Voltage	3.7 kV AC for 1 minute (between input terminals and casing, for 73201, 73202, 73203) 5.55 kV AC for 1 minute (between input terminals and casing, for 73204)
Power Supply	Two AAA (LR03 or R03) dry cells
Battery Life	Approx. 600 hours (for continuous DC voltage measurement with alkaline cells)
Auto Power Off	The power is automatically turned off when no operation is made for approx. 20 minutes (can be disabled). N/A for 73204
Dimensions	74 (W) x 155 (H) x 31 (D) mm
Weight	Approx. 240 g (including batteries)
Compliance with Standards	Safety EN61010-1 (1995) + Amend; EN61010-2-031 (1995) (600 V, CAT II; 300 V, CAT III; contamination level 2, indoor use: 73201, 73202, 73203) (600 V, CAT III; contamination level 2, indoor use: 73204) EMC EMI: EN55011 (1991) (Class B, Group 1) EMS: EN50082-1 (1997)
Standard Accessories	Instruction manual: 1 Test lead set (RD031): 1 AAA (LR03/R03) dry cells (built in): 2 Spare fuse F05 (500 mA/250 V, not included for 73204): 1 Spare fuse F02 (15 A/250 V, not included for 73204): 1

Options

Option Code	Specification
732□□/R	With rubber case

Optional Accessories

Name	Model	Specification
Fuse	F05	500 mA/600 V
	F02	15 A/600 V
Test leads	RD031	Red / black (1 set)
Carrying case (hard)	B9646GB	Houses the DMM and test leads
Rubber case	93007	For DMM

Performance

Test conditions: Temperature and humidity = 23°C ± 5°C, 80% RH or less; Accuracy = ±(% of reading + digits).
Note: Response time is the time required for achieving accuracy specified for the corresponding range.

• DC Voltage Measurement (V_{DC})

Range	Accuracy			Input Resistance	Maximum Input Voltage					
	73201	73202/04	73203							
400.0 mV	0.5% + 1	0.5% + 1	0.3% + 1	>100 MΩ	600 V					
4.000 V				11 MΩ						
40.00 V	10 MΩ									
400.0 V				0.75% + 1						
600 V										

Response time: 1.5 seconds or less for 400 mV range, 1 seconds or less for all other ranges

• AC Voltage Measurement (V_{AC})

Mean-value detection and RMS-value calibration

Range	Accuracy			Input Resistance	Maximum Input Voltage
	73201	73202	73203/04		
4.000 V	1% + 5		0.75% + 5	>11 MΩ, <50 pF	600 Vrms
40.00 V					
400.0 V					
600 V					

Response time: 2 seconds or less

• DC Current Measurement (A_{DC})

Not available with 73204

Range	Accuracy			Voltage Drop	Maximum Input Current
	73201	73202	73203		
400.0 μA *1	1% + 2			<0.17 mV/μA	400 mA (500 mA/600 V fuse-protected)
4000 μA					
40.00 mA *1					
400.0 mA					
4.000 A	2% + 2			<0.04 V/A	10 A (15 A/600 V fuse-protected)
10.00 A *2					

*1: Drift in the least significant digit may occur.

*2: Measurement of 11 to 20 A can be performed within 30 seconds. A warning buzzer sounds when 30 seconds have passed.

Response time: 1 second or less

• AC Current Measurement (A_{AC})

Not available with 73204

Mean-value detection and RMS-value calibration

Range	Accuracy (40 – 500 Hz)			Voltage Drop	Maximum Input Current
	73201	73202	73203		
400.0 μA*1	2% + 20			<0.17 mV/μA	400 mA (500 mA/600 V fuse-protected)
4000 μA	2% + 5			<3 mV/mA	
40.00 mA*1	2% + 20				
400.0 mA	2% + 5			<0.04 V/A	10 A (15 A/600 V fuse-protected)
4.000 A	2.5% + 20				
10.00 A*2					

*1: Drift in the least significant digit may occur.

*2: Measurement of 11 to 20 A can be performed within 30 seconds. A warning buzzer sounds when 30 seconds have passed.

Response time: 2 second or less

• Resistance Measurement (Ω)

Range	Accuracy	Maximum Testing Current	Open-circuit Voltage	Input Protection Voltage
	73201 to 73204			
400.0 Ω	0.75% + 2	<1 mA	<3.4 V	600 V
4.000 kΩ	0.75% + 1	<0.5 mA	<1.0 V	
40.00 kΩ		<70 μA	<0.7 V	
400.0 kΩ		<7 μA		
4.000 MΩ		2% + 1		
40.00 MΩ	5% + 2	<70 μA		

Response time: 1 second or less for 400 kΩ range or less, 5 seconds or less for 4 MΩ range, 15 seconds or less for 40 MΩ range

• Continuity Check ()

Range	Continuity Beeper		Open-circuit Voltage	Input Protection Voltage
	73201 to 73204			
400.0 Ω	Buzzer sounds at 50 ± 20 Ω or less		<3.4 V	600 V

Response time: 0.2 second or less (buzzer response)

• Diode Test ()

Range	Accuracy		Open-circuit Voltage	Input Protection Voltage
	73201 to 73204			
2.00 V	1% + 1 (testing current 1 mA or less)		<3.4 V	600 V

Response time: 1 second or less

• Capacitor Check ()

Range	Accuracy			Input Protection
	73201/04	73202	73203	
20.00 nF	Not available	2% + 5, typical (20 nF range: Accuracy after zero calibration)		500 mA/250 V fuse-protected
200.0 nF				
2.000 μF				
20.00 μF				
200.0 μF				

Response time: 1 second or less

Model
753603



3.5
digits

3200
count

Refer to page 9 for optional accessories.

Test conditions: Temperature and humidity = 23°C ± 5°C, 80% RH or less;
Accuracy = ±(% of reading + digit)


Model		753603
Display		Digital display: 3200-count digital reading; bar graph: 32 segments
Measuring Rate		Digital display: 2 times/sec; bar graph: 12 times/sec
Measurement Functions	DC Voltage (basic accuracy)	300.0 mV – 450 V (0.7 % + 2)
	AC Voltage (basic accuracy)	3.000 – 450 V (2.3% + 5)
	Resistance (basic accuracy)	300.0 Ω – 30.00 MΩ (2% + 2)
Continuity Check		Buzzer sounds at approximately 20 Ω or less.
Additional Functions		Data hold, diode test
Usable Circuit Voltage		250 V or less
Power Supply		Two LR44 or SR44 dry cells
Battery Life		Approx. 250 hours (for continuous DC voltage measurement with SR44 cells)
Auto Power Off		The power is automatically turned off when no operation is made for approximately 10 minutes (can be disabled).
Dimensions		51 (W) x 106 (H) x 10 (D) mm
Weight		Approx. 110 g (including batteries and case)
Safety Standards		Conforms to EN61010-1 safety standard
Standard Accessories		Instruction manual: 1, LR44 cells: 2, Pocketbook-style case: 1

Basic Usage Digital Multimeters

Voltage/Resistance Measurement

The COM terminal and V/Ω terminal are used. To measure a voltage, set the dial to voltage measurement. To measure a resistance, set the dial to resistance measurement. Some DMM models can also display the frequency and calculated decibel value at the same time when measuring an AC voltage. During resistance measurement, it is possible to switch the function to checking of the continuity of the measured circuit.


Measuring a Voltage and Resistance

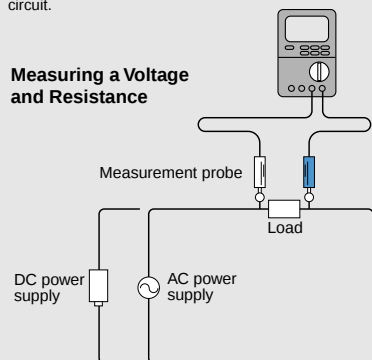

Current Measurement

The COM terminal, and A, μA or mA terminal are used. Some models have shutters for preventing erroneous insertion into the current terminals and allow a contact of a lead to a current terminal only when the dial is set to current measurement. For these models, you cannot set the dial to voltage measurement while a lead is left inserted into a current terminal. This feature provides greater safety.


Measuring a Current

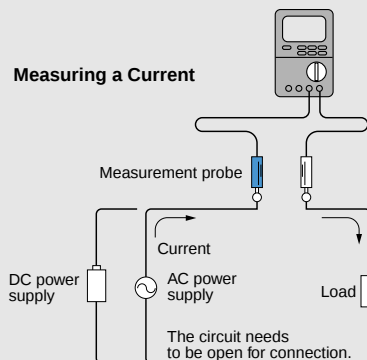


Diode Test

A current flows through a diode when the power supply is connected as (1) below, while, almost no current flows when the power supply is connected as (2). The diode test function applies an adequate forward voltage across a diode to make a constant current flow and measures the voltage drop in the forward direction to determine the forward and reverse directions of the diode.

Checking the Polarity of a Diode

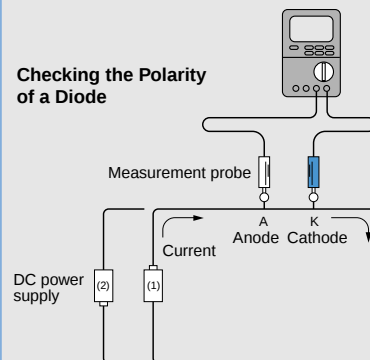


Optional Accessories and Spare Parts


Name	Model	Specification	Applicable DMM Models	Appearance
DMM communication package	92010-E	Communication cable (D-Sub 9-pin female) + software	734 series	
	92010-E/P	Above + RS 232 cable for printer (Model 91015)	734 series	
Printer	97010	Thermal printer (paper width: 112 mm)	734 series	
AC adapter for printer	94006 94007	(For Europe) 230 VAC $\pm 10\%$ (For USA) 120 VAC $\pm 10\%$	734 series	
Thermal print paper	97080	One package of 10 rolls	734 series	
Test leads	RD031	L-plug, Red / black(1set)	All models except 7536	
	B9646HA	Red / black(1set)	753603	
Alligator clips	B9646HF	Red / black(1set)	All models	
Fuse	F02	15 A/250 V	73201 / 73202 / 73203	
	F05	500 mA/250 V	73201 / 73202 / 73203	
	A1518EF A1519EF	500 mA/600 V	733 / 734 series	
			733 / 734 series	
Rubber case	93007		732 series	
Carrying Case	B9646GB	Hard case	732 series	
	B9646HH	Hard case	733 / 734 series	
	93014	Hard case (also for housing RS-232C cable)	734 series	
Pocketbook-style case	B9646HB	Hard case	753603	
Thermistor probe	234901	-50°C to 150°C (for liquid)	733 series	
Temperature (thermocouple type K) probe	90050	-50°C to 600°C (for liquid)	734 series	
	90051	-50°C to 600°C (for liquid)	734 series	
	90055	-20°C to 250°C (for surface)	734 series	
	90056	-20°C to 500°C (for surface)	734 series	
Current clamp probe	96001	For 400 A AC; 10 mV/A AC output Note: Use AC voltage range of the DMM. Note: Need to convert the meter reading. EX) read the DMM indication of 1 V as 100 A.	All models except 7536	
Hygrothermal probe	90001	0 to 95% RH; 1 mV/% RH output -10°C to 50°C; 1 mV/°C output Note: Use DC mV range of the DMM. Note: Need to convert the meter reading. EX) read the DMM indication of 50 mV as 50% RH.	All models except 7536	

Detailed Specification and Dimensions of Temperature probe


Model and Ordering code	Probe type	Measuring range	Sensor Diameter	Sensor Length	Accuracy
90050	Rounded end	-50 to 600°C [-58 to 1112 F]	3.2 mm dia	200 mm long sheath	0.4% or $\pm 1.5^\circ\text{C}$ ($\pm 2.7^\circ\text{F}$)
90051	Rounded end	-50 to 600°C [-58 to 1112 F]	1.6 mm dia	150 mm long sheath	0.4% or $\pm 1.5^\circ\text{C}$ ($\pm 2.7^\circ\text{F}$)
90055	Surface straight	-20 to 250°C [-4 to 482 F]	Diameter of temp. sensing portion 15 mm		0.75% or $\pm 2.5^\circ\text{C}$ ($\pm 4.5^\circ\text{F}$)
90056	Surface straight	-20 to 500°C [-4 to 932 F]			0.75% or $\pm 2.5^\circ\text{C}$ ($\pm 4.5^\circ\text{F}$)




90050



90055



90051



90056

Integral Action Time

Digital multimeters (DMMs) employ an A/D converter with a dual-integration system, which determines the measurement value by converting the input voltage into time using an integration AD converter. The interval to perform an integral action periodically is referred to as the integral action time.

Measurement Accuracy

With DMMs, the measurement accuracy is generally expressed as: $\pm$ % of reading + ___ digits. ("Reading" refers to the reading value, and is abbreviated as "rdg"; "digits" refers to the number displayed in the smallest decimal place, and is abbreviated as "dgt.") This expresses the range of values that a DMM may measure or represent for a given actual value.

Root Mean Square Value

The value most directly related to the energy of a given waveform. Refers to the square root of a value found by averaging the squares of instantaneous values of a waveform over a single cycle. (See Table 1, Figures 1 and 2.)

Mean Value

Refers to the average of the sum of instantaneous values, determined for a current half-wave. It is equivalent to calculating the surface area of a waveform.

Form Factor

Ratio of RMS value with respect to average value.
Form factor = RMS value/mean value (See Figures 1 and 2.)

Crest Factor

Ratio of maximum value to RMS value.
Crest factor = maximum value/RMS value (See Figures 1 and 2.)

Peak-to-Peak (P-P) value

Refers to the distance between the smallest and largest amplitudes in a waveform (see Figure 1).

Frequency Characteristic

Refers to a characteristic that shows variations in input, measurement, or response with frequency. When measuring alternating current signals, a measured signal does not have a simple frequency, but often includes various frequencies ranging from lower frequencies to higher harmonics. To measure such signals more accurately, it is preferable to use a measurement device that has a broader frequency characteristic range.

Input Impedance

To prevent the measured object from being influenced during voltage measurement, you should use a measurement device with an extremely high input impedance.

Decibel

A unit used for describing the change in electrical signal amplitude or noise level, or transmission systems in wired devices, etc. This parameter is also used to represent the level differences in voltage, current or related values, but is generally restricted to cases characterized by the relationship: $(V_1/V_2)^2 = P_1/P_2$. In the abbreviation "dB," "d" (dec) denotes 1/10, and "B" (Bell) denotes logarithm.

Table 1. RMS Value, Average Value, Waveform Factor and Crest Factor for a Typical Periodic Waveform




Item	Waveform	RMS	Mean value	Waveform factor	Crest factor
Sine wave		$\frac{1}{\sqrt{2}} = 0.707$	$\frac{2}{\pi} = 0.637$	$\frac{\pi}{2\sqrt{2}} = 1.11$	$\sqrt{2} = 1.414$
Half rectification wave		$\frac{1}{2} = 0.5$	$\frac{1}{\pi} = 0.318$	$\frac{\pi}{2} = 1.571$	2
Full rectification wave		$\frac{1}{\sqrt{2}} = 0.707$	$\frac{2}{\pi} = 0.637$	$\frac{\pi}{2\sqrt{2}} = 1.11$	$\sqrt{2} = 1.414$
Triangular wave		$\frac{1}{\sqrt{3}} = 0.577$	$\frac{1}{2} = 0.5$	$\frac{2}{\sqrt{3}} = 1.155$	$\sqrt{3} = 1.732$
Square wave		1	1	1	1

Figure 1. RMS and Mean Values of Sine Wave


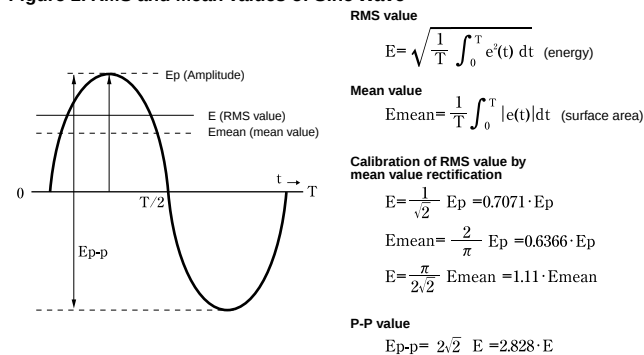


Figure 2. RMS of Distorted Waves

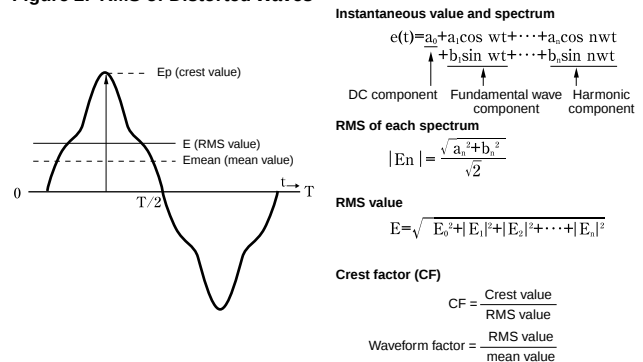

CE Mark

The products of Yokogawa M&C Corporation are subjected to design and evaluation testing to ensure compliance with the safety and EMC standards in accordance with the directives issued by the EC.

Electromagnetic Compatibility (EMC)


The parameters EMI and EMS are referred to as electromagnetic compatibility as they relate to compatibility within an electromagnetic environment.

Safety Standards

These standards lay out safety requirements that are to be met by a product with the objective of the preservation of human life and property. The applicable international standard is IEC 61010, and while a product must conform to this standard, there are also domestic standards laid out by individual countries. With these safety regulations, the range of use of a measurement device is specified by categorization in overvoltage categories I through IV to ensure the safety of the user. The designations "CAT II, 1000 V" or "CAT III, 600 V" at the input terminals of a measurement device, for example, indicates the applicable category and the maximum voltage for the device in terms of safety.

Overvoltage categories (CAT)

In order to ensure the safety of the user, IEC 60664 defines the ranges of use of measuring instruments by classifying power levels into overvoltage categories I through IV. This is because the excessive impulse or surge levels induced in a power line vary depending on the location of measurement (category). Categories with higher numerals designate locations that include larger surge voltages. Instruments that are designed for category III can thus withstand higher surge voltages than instruments designed for category II.

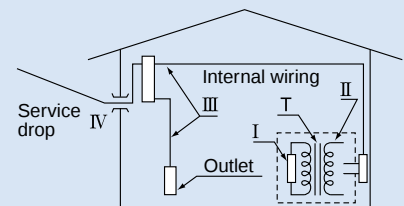

Overvoltage category I (CAT I):

Secondary circuits connected to an outlet via a power transformer.

Overvoltage category II (CAT II):

Primary circuits of a device connected to an outlet with a power cord.

Overvoltage category III (CAT III):

Primary circuits of a device to which power is directly supplied from the power distribution panel, and circuits from the distribution panel to outlets.

Overvoltage category IV (CAT IV):

All service line entrance circuits through the power distribution panel

 NOTICE

- Before using the product, read the instruction manual carefully to ensure proper and safe operation

YOKOGAWA M&C CORPORATION 2-9-32 Nakacho, Musashino-shi, Tokyo, 180-8750 Japan
International Sales Dept. Phone: +81-422-52-5716 Facsimile: +81-422-55-8954

YOKOGAWA CORPORATION OF AMERICA
2 Dart Road, Newnan, GA. 30265-1094 U.S.A.
Phone: +1-770-253-7000 Facsimile: +1-770-251-2088

YOKOGAWA EUROPE B. V.
Databankweg 20, 3821 AL Amersfoort, THE NETHERLANDS
Phone: +31-334-64-1611 Facsimile: +31-334-64-1610

YOKOGAWA ENGINEERING ASIA PTE. LTD.
5 Bedok South Road, Singapore 469270 SINGAPORE
Phone: +65-6241-9933 Facsimile: +65-6241-2606

YOKOGAWA AMERICA DO SUL LTDA.
Praça Acapulco, 31-Santo Amaro, São Paulo/SP, BRAZIL CEP-04675-190
Phone: +55-11-5681-2400
Facsimile: +55-11-5681-1274/4434

**YOKOGAWA MEASURING INSTRUMENTS
KOREA CORPORATION**
City Air Terminal Bldg., 405-9, #159-6, Samsung-dong,
Kangnam-ku, Seoul, 135-728 KOREA
Phone: +82-2-551-0660 Facsimile: +82-2-551-0665

YOKOGAWA AUSTRALIA PTY. LTD.
Centrecourt D1, 25-27 Paul Street North, North Ryde,
N.S.W. 2113, AUSTRALIA
Phone: +61-2-9805-0699 Facsimile: +61-2-9888-1844

YOKOGAWA BLUE STAR LTD.
40/4 Lavelle Road, Bangalore, 560 001 INDIA
Phone: +91-80-227-1513 Facsimile: +91-80-227-4270

YOKOGAWA MIDDLE EAST E.C.
P.O. BOX 10070, Manama, Building 577, Road 2516,
Busaiteen 225, Muharraq, BAHRAIN
Phone: +973-358100 Facsimile: +973-336100

LTD. YOKOGAWA ELECTRIC
Gorkholskiy per. 13, Build. 2, 4th Floor, 129090, Moscow
RUSSIAN FEDERATION
Phone: +7-095-737-7868 Facsimile: +7-095-737-7869

Represented by:

MCK-EM10